

Zlin Aviation S.R.O.

2. Kvetna 685
763 61 Napajedla
Czech Republic

Safety Alert	N°05	28 JAN 2011
--------------	------	-------------

MANDATORY

- **Airplanes affected:**
Savage Aircrafts Serial numbers from 001 to 090.
- **Subject:**
Visual control and eventual removal of disengaged false ribs.
Report immediately (in case of disengagement) to Zlin Aviation sro.for further instructions!
- **Reason:**
Disengagement of some false ribs inside one costumer's wing was reported (see the picture).

- **Compliance:** Issue date of SA
- **Material required:** Mirror and flashlight.
- **Accomplishment:** There are 9 false ribs in each wings.
 1. Open the inspection plates in the bottom of the wing.
 2. Use mirror and flashlight and look inside the wing for any free disengaged false ribs.
 3. If some disengaged ribs will be found, remove them from the wing.

NOTE: This issue would have been caused by aging of the glue, which was used to fit false ribs to the metal sheet in the main wing spar.

 4. Please contact Zlin Aviation company for further steps in reparation.

Picture of the false rib:

