

Zlin Aviation S.R.O.

2. Kvetna 685
763 61 Napajedla
Czech Republic

Service Bulletin	N°08	04 FEB 2013
-------------------------	-------------	--------------------

CAUTION

· **Airplanes affected**

All Savage models

· **Subject**

Exhaust pipe fixation inspection

· **Reason**

The loss of a final exhaust pipe on a Kit built Savage Classic has been reported. There has been no consequence for occupants, other persons and for the aircraft.

· **Cause**

The exhaust pipe was not secure with rivets

· **Accomplishment**

Before your next flight, perform the following check (with cold engine!):
verify the fixation of the exhaust pipe, that to be correct (like on all factory assembled aircrafts) has to have both a metal clamp and also at least 2 rivets for safety (the rivets hold the final pipe with the tube that is welded to the exhaust bottle, and are fixed over the metal clamp to hold it also and prevent it from falling down).

In case you detect that there are no rivets, an upgrade has to be done to prevent possible loss of the pipe in flight. Contact us if additional detailed instructions are needed.

· **Qualification**

Owner/LSRMA

· **Compliance**

Issue date of Service Bulletin.

· **Picture**

Position of the rivets.

